ECS Configuration Change Request					Page 1 of 2 Page(s)				
1. Originator	2. Log Date:	3. CCR #:		4. Rev			6. Rm #:	7. Dept.	
Evan Winston	14 2MY 00	00-0	735	_	301.925.0348		2013	DEV/CO	
8. CCR Title: Test Executable 5A.06 Faun Firebird.04 for Delivery to DAACs and VATC04 adds fix for NCR 27342.									
9. Originator Signature/Date			10. C	lass	11. Type:		12. Need Date: 14 July 2000		
anthy W ()	2/14/00	-77-		CCR					
13. Office Manager Signature/Date			14. Category		· 1	15. Priority: (If "Emergency" fill in Block 28).			
(Kingly h) Se to Will thanks 7/17/00			Update ECS Baseline Doc.			Emergency			
				7. Schedule 18. Cl(s) Affected:DPS					
1/			lmpact: N/A	•					
19. Release Affected by thi	20. Date due t	e to Customer: 21. Estimate				:			
5A				None - Under 100K					
22. Source Reference: NCR (attach) Action Item Tech Ref. GSFC Other: .04 corrects: ECSed 27342.(attached) .03 corrected: ECSed26848 Previous Firebird.02 corrected: 18274,26040,26356.									
23. Problem: (use additional Sheets if necessary) Execution Manager should not hold lock while tarring files for Prod Hist (reported by GSFC)									
Jobs at the GDAAC hold the DPS Resource Lock in the post execution phase of processing while creating the Production History tar file. It is unecessary to lock the database tables during this time and results in severely impeding processing.									
24. Proposed Solution: (use additional sheets if necessary) Fix to ECSed27342 corrects the problem by Release lock in the post-execute method in DpPrExecutionManager.cxx prior to tarring files into the production history log file.									
This requires that the DPS executable, EcDpPrEM, be delivered by this Test Executable. EcDpPrEM was previously delivered (along with EcDpPrDM) in Firebird.03.									
25. Alternate Solution: (use additional sheets if necessary) None									
26. Consequences if Change(s) are not approved: (use additional sheets if necessary) DAAC must work around problem.									
27. Justification for Emergency (If Block 15 is "Emergency"): Should be provided as soon as possible to solve the processing throughput problem.									
28. Site(s) Affected: DEDF DPVC VATC DEDC GSFC DEOC DEOC DEOC DEOC DEOC DEOC DEOC DEO]SM			
29. Board Comments:				30. V	Work Assigned T	0:	31. CCR C	losed Date:	
32. EDF/SCDV CCB Chair (S	Y, , '	isposition: Ap	oproved)	App/Co	m. Disapproved	Wi	thdraw Fwo	J/ESDIS ERB	
N pro-	7 (14 (100		wd/ECS						
33. M&O/CdB Chair (Sign/D	Pate): D	isposition: Ap	proved	App/Co	m. Disapproved	W	ithdraw Fwd	/ESDIS ERB	
Kenneth Ltrucket	7		wd/ECS						
34. ECS CCB Chair (Sign/Da	ate): Dis	sposition: App	proved	App/Coi	m. Disapproved	Wi	ithdraw Fw	d/ESDIS ERB	
		Fw	/d/ESDIS	3				ı	

VUIVIVI VI

ADDITIONAL SHEET

CCR #: 00-0735 Rev: - Originator: Evan Winston

Telephone: 301.925.0348 Office: DEV/CO

Title of Change: Test Executable 5A.06 Faun Firebird.04 for Delivery to DAACs and VATC. .04 adds fix for NCR 27342...

CM: PLEASE, build Sun TAR file(s) for the listed files from current 5A baseline and provide to the SMC.

/ecs/formal/ PDPS/DPS/bin/sun5.5/EcDpPrEM /ecs/formal/ PDPS/DPS/bin/sun5.5/EcDpPrDM

SMC: Receive the TAR file(s) and make available to the DAACs.

DAAC Install instructions:

Firebird.04 TE provides Fix for 27342 requested by GSFC, problem exists at all DAACS,

Note: The following options for Firebird TEs:

- a. If you are running with Firebird.02, you may continue to use Firebird.02 without loading .03 or.04 (but you will not have the solution to NCRs 26848 and 27342).
- b. You may load Firebird.04 on top of Firebird.03 -- If so you need only replace EcDpPrEM
- c. You may load Firebird.04 on top of Firebird.02 -- If so you need to replace both EcDpPrEM and EcDpPrDM.
- d. You may load Firebird.04 on top of 5A.05 Electra even if no other Firebird TEs were installed previously -- If so you need to replace both EcDpPrEM and EcDpPrDM. Or,
- e. You may continue to operate without any Firebird TE.

Instructions:

- Get TAR File from SMC distribution; un-TAR and Use the 'cp' from the command line to install/replace files.
- REPLACE all occurrances of the files included with this TE mode-by-mode, using the same permissions levels and
 ownerships as previous file. Target directory is: /usr/ecs/OPS/CUSTOM/bin/DPS
 Normally these files are loaded on the PDPS "queuing server" machines: x0sps0x (eg: g0sps06 or l0sps03), but this may vary
 from site to site.

CM01AJA00

